Tech Note

Adjusting squelch calibration in MD-380 / MD-390 / RT3 / RT8 DMR radios to resolve reception issues encountered with version 5 hardware models.

SYMPTOMS:

After the radio is updated with any custom firmware based on OEM version 013.020 firmware, the radio seems to stop receiving transmissions approximately 5 seconds after last activity. This includes all MD380tools based custom firmware, and possibly other variants.

Normal reception is restored briefly by adjusting the channel encoder or pressing one of the keyboard buttons. However, the radio falls silent soon thereafter.

Another symptom is the green activity LED does not illuminate during reception. If the radio is then flashed with the original OEM version 014.x firmware, normal operation resumes.

HARDWARE AFFECTED:

Models that shipped with OEM firmware version 014.x are affected. The hardware version from the Basic Information page in the TyT CPS application also may indicate V05.x.

Basic Information	
Frequency Range	[400-480MHz]
Last Programmed Date	2018-06-08 08:49:24
Model Name	MD 390
Serial Number	180
CPS Software Version	V01.30
Hardware Version	V05.01
MCU Version	D014.004
Unique Device ID	ALSON COLOR OF A STATE

WARNING



The procedure described below may affect your radio in undesirable ways. You will be accessing a settings screen that is used by the factory during the manufacturing process.

These setting values were determined by specialized measurement equipment of which you are unlikely to have access to.

Before changing any values, document existing values with a screen shot or other permanent documentation method.

ITEMS NEEDED:

CPS software from tyt888.com

MD-390 SOFTWARE 0321

http://tyt888.com/uploadfile/upfiles/20170321133947.zip

Note: Version 1.37 works with both MD-380 and MD-390 models. (Without or with GPS) Only a Windows OS version is available. Use the Retevis CPS if you have an RT3 or RT8. The remaining instructions assume use of the TyT CPS.

Programming cable suitable for your radio model.

That's it. Likely you already have the CPS program installed. If not, download, and extract the zip file into a temporary location. Then, run the installer as usual. It's name is: CPS MD390 Setup v1.37.exe

STEPS:

Connect your radio, and turn the power on. Verify that CPS can read your radio by executing the Read command from the *Program* | *Read data* menu selection or just click the toolbar icon.

Program Setting	View Wine	File	Edit	Program	Setting	View	Window	Help
Read data	Ctrl+R	C	2	🖬 📲 🔸	4 💡			
Write data	Ctrl+W						∃ x [

You might take this opportunity to save the code plug data you just read out to a file. Click the Save icon (floppy disk) and give it a suitable filename.



Now, close the CPS program.

You now need to make a slight edit to the "settings.ini" file located in the program directory with the CPS program. To find the file location, locate the icon for CPS on your desktop, **right click** on it.



Select *Properties* from the pop-up context menu.

PS MD380 V1	.37 Properties		×
Security	Details	Pre	vious Versions
General	Shortcut		Compatibility
CPS	MD380 V1.37		
Target type: A	pplication		
Target location: 1	37		
Target:	Files (x86)\Tytera\M	D_390\1.3	7\CPS-DMR.exe"
Start in: "	C:\Program Files (x: None	86)\Tytera\	MD_390\1.37"
Run: M	Normal window		\sim
Comment:			
Open File Loca	ation Change	lcon	Advanced
	ОК	Cance	Apply

Click on the *Open File Location* button. Your location could be different, but the files should be the same. Make note of this location.

📕 🛃 📕 🖛 C:	:\Prog	ram Files (x86)\Tytera	\MD_390\1.37						
File Home	Shar	e View							
Pin to Quick Copy access	📋 Paste	✓ Cut Image: Copy path Image: Paste shortcut	Move Copy to •	Delete Renar	ne New folder	item • access •	Properties] Open ▼ → Edit → History	Select all Select none
Cli	ipboard	d	Org	anize	New		Ope	n	Select
$\leftarrow \rightarrow \checkmark \uparrow$	→ T	hinkPad → Window	s10_OS > Progra	am Files (x86)	> Tytera > MD_390	» 1.37			
documents	^	Name			Date modified	Туре		Size	
nosleep		🔬 setting.ini			1/7/2018 10:07 AM	Configu	uration sett	1 K	В
🭌 v1.5		setup.log			1/3/2018 4:55 PM	Text Do	cument	3 K	В
🗱 Dropbox		📄 english.lang			2/20/2017 4:05 PM	LANG F	ile	12 K	В
		📄 chinese.lang			2/20/2017 4:05 PM	LANG F	ile	11 K	В
less oneDrive en less construction en less construction en les en		Lig CPS-DMR.ex	e		2/20/2017 4:01 PM	Applica	tion	629 K	В
ThinkPad		🔬 keydata.ini			6/15/2016 4:26 PM	Configu	uration sett	2 K	В
		🗟 STDFU.dll			5/8/2011 4:58 PM	Applica	tion exten	356 K	В
J SD Objects		STTubeDevic	e30.dll		5/8/2011 4:58 PM	Applica	tion exten	1,680 K	В
Desktop		🤯 uninstall.exe			10/18/2003 6:58 PM	Applica	tion	63 K	В
🔮 Documents		mfc42.dll			8/14/2002 4:51 AM	Applica	tion exten	973 K	В
👆 Downloads		MSVCRT.DLL			7/22/2002 5:05 AM	Applica	tion exten	285 K	В

Click on the Start button in the lower left corner of your screen. Choose "Search" if it offers it to you or just start typing the word "notepad". A windows search should begin, resulting in a list of files named notepad on your computer.



If you are prompted by Windows to allow the program to "*make changes to your computer*", choose "Yes." The Notepad program should now be open with a blank

document. You need to run Notepad as administrator because you will need to have elevated permissions to save changes to the settings file.

Use the *File* | *Open* .. menu in Notepad to navigate to the Program Files directory you noted above for the CPS program. Choose the file "settings.ini" and open it in Notepad.

Your file will look similar to this. Scan down the [setup] section looking for a setting called "testmode".

If found, change it to "1"

If not present, add a line as shown here.

Save the file and close Notepad.

setting.ini - Notepad File Edit Format View Help [setup] language=chinese testmode=1 model=MD390 oemmode1=MD390 oemindex=255 windowtext=CPS MD390 readwrite=0 chcount=1000 zonecount=250 password=0 readmodel=0 exeflag=0 exepassword=777777 languagemenu=1 jstdefault=0 voiceencrypt=1 timesetting=0 gpssystem=1

7-Zip

Next, verify your radio is still connected to your computer with the programming cable, and is powered on.

Launch the CPS program again.



Here where the fun begins.

Press Ctrl + T at the same time. It takes a moment for the CPS application to connect to the radio, and retrieve the calibration data.

If you get a "connection failed" error message, try Ctrl + T again. If you still get the connection error. Turn off your radio, *remove the battery* for a few seconds, then replace it. Power the radio back on. Now try Ctrl + T again.

You should be presented with the *Test Mode* screen. The data values are specific to your radio, so don't worry as the numbers certainly will be different than mine.

is screen are set at the	Func Para/Freq	1	2	3	4	5	6	7	8	9	
factory and are specific to your radio. Do not copy values from radio to	Rx Freq	401.03500	411.03500	421.03500	431.03500	441.03500	451.03500	461.03500	471.03500	479.99500	
	Tx Freq	401.14500	411.14500	421.14500	431.14500	441.14500	451.14500	461.14500	471.14500	479.95000	
	VOX 1					10	The two fields have similar meaning, but are specific to the memory channel's setting for Squelch: Normal or Tight You may need to adjust both of them upward. Start by adding 8 to the original value. Click Write to save it to the radio. Only adjust upward until you get reliable results.				
radio!	VOX 10	Squelch calibration value changes that may be needed for v5.x hardware MD-380 / MD-390 radios using custom firmware based on 013.020 firmware. If your values in these two boxes are less than 25, you may be experiencing the "5 second sleep" issue. Make note of your original values before changing anything!				150					
	Rx Low Voltage					137					
	Rx Full Voltage					173					
lake a screen shot of	RSSI 1(-120dBm)					75					
ur original values here	RSSI 4(-70dBm)					130					
safe keeping. You can	Analog Mic					123					
owever the risk is on	Digital Mic					127					
you if you mess up	Freq Adjust(High)					98					
you in you moos up.	Freq Adjust(Mid)					107					
	Freq Adjust(Low)					110					
	Tx Hight Power	139	138	138	137	136	139	143	140	137	
	Tx Low Power	88	85	82	82	82	78	75	72	69	
	Rx Sentivity	110	125	140	160	180	191	203	218	233	
light Squeich	Open SQL 9	4	4	4	14	25	14	4	4	4	
	Close SQL 9	9	10	12	11	10	9	8	9	11	
Normal Squelch	Open SQL 1	20	21	22	23	25	24	23	27	31	
	Close SQL 1	37	34	31	34	37	34	32	33	35	
	Max Volume	3	3	4	4	4	4	4	4	4	
	CTCSS(67Hz)	40	39	39	38	37	36	35	34	34	
	CTCSS(151.4Hz)	47	46	45	43	42	41	41	40	40	
	CTCSS(254.1Hz)	63	63	63	60	57	55	54	53	53	
	DCS Mod2	100	100	100	100	100	100	100	100	100	
	DOC NO. 11	32	31	30	29	29	28	28	28	28	

At this point, take a screen shot of this window <u>NOW</u>. You can use the "Snipping Tool" in Windows to do so. Save this screenshot with a filename denoting it is the original factory calibration values.

Note, I have added a LOT of informational text to this screen shot that won't be on your screen!

The important values that we want to change are on the lines labeled *Open SQL* 9 and *Open SQL* 1. These values correspond to the "Tight Squelch" and "Normal Squelch" selections for each channel memory. In case you have set some of your channel memories to "Tight", we will need to change the values in both places.

They are likely different values from each other right now.

The only important ones are the values in the column with complete information. In my sample screenshot, that is column #6. That may vary, depending on what frequency band your radio is configured for. Just use the column that has full values and ignore the other columns.

The next part is not scientific. You may need to experiment a little to obtain success. As a guide, try taking the original value, and add 8 to it, and edit the value in the box.

My radio began to operate normally with the edited numbers equal to 24. I added one to that value to make sure it didn't fall back over the edge. So for this radio, they both ended up as 25.

When you are ready to save the new values back into the radio, click the *Write* button. The complete set of values will be written back to the radio and it will reboot.

The easiest way to test out the changes is with another radio. Select the same simplex frequency on both, and transmit from the other radio, and see if the receiver opens up. You should be able to wait only about 10 seconds and try it again. If the operation seems normal, you are done! If not, go back into the Test Mode screen and increment each of the two values until the radio acts normally.

Finally, I would go back into the Test Mode screen, and take another screenshot. Save it with an appropriately different filename denoting the fixed values.

Since we just changed the thresholds for Normal and Tight squelch, it is possible that they won't act as they were originally intended.

Fortunately, these calibration values persist, even if you update the firmware.

You are done. Be sure to document what you have changed, so you can retrace your steps in the future.

Warren Merkel, KD4Z

Document revision: 1 31 October 2019

This document may change as more feedback is received. The latest version of this document can be found on the KD4Z Toolkit project page on Github here:

https://github.com/KD4Z/md380tools-vm

Be sure to visit the support page for the KD4Z Toolkit on Facebook here:

https://www.facebook.com/groups/KD4ZToolkit/